


## **Screws** Head Dimensions

## Machine

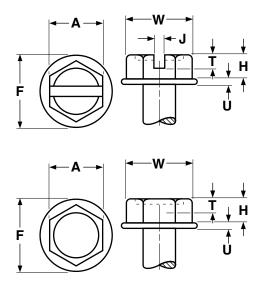

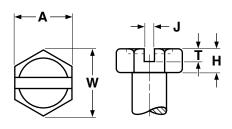

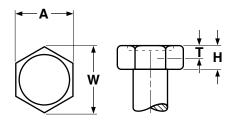

HEX HEADS AND HEX WASHER HEADS FOR MACHINE SCREWS  ASM B18.6.3-200													
Nominal Size	A Width Across Flats		W Width Across Corners	H Height of Head		F Diameter of Washer		U Thickness of Washer		J Width of Slot		T Depth of Slot	
	2	.125	.120	.134	.050	.040	.166	.154	.016	.010	-	-	-
4	.188	.181	.202	.060	.049	.243	.225	.019	.011	.039	.031	.042	.025
5	.188	.181	.202	.070	.058	.260	.240	.025	.015	.043	.035	.049	.030
6	.250	.244	.272	.093	.080	.328	.302	.025	.015	.048	.039	.053	.033
8	.250	.244	.272	.110	.096	.348	.322	.031	.019	.054	.045	.074	.052
10	.312	.305	.340	.120	.105	.414	.384	.031	.019	.060	.050	.080	.057
12	.312	.305	.340	.155	.139	.432	.398	.039	.022	.067	.056	.103	.077
1/4	.375	.367	.409	.190	.172	.520	.480	.050	.030	.075	.064	.111	.083
5/16	.500	.489	.545	.230	.208	.676	.624	.055	.035	.084	.072	.134	.100
3/8	.562	.551	.614	.295	.270	.780	.720	.063	.037	.094	.081	.168	.131
1/2	.750	.735	.820	.400	.367	1.040	.960	.085	.050	-	-	-	-